

电子外卡规

- 适用于测量外圆、外圆槽及其它不易测量的外尺寸。
- 表盘可旋转 $\pm 170^\circ$ ，方便数值的读取。
- 通电后，显示值即为绝对测量的起始值。
- 有数字显示和模拟表显示，模拟显示的分辨率可自动切换。
- 模拟显示范围： ± 20 格。




开关键	√
绝对、相对测量模式转换键	√
公制、英制测量模式转换键	√
显示数据输出键	√
绝对测量初始值设置键	√
记忆最大值、最小值或保持显示	√
设置公差	√
电池型号	CR2032
自动断电	√
数据输出口	√
接口电缆（选配）	P1104

行程 10mm

507-11-012

货号	测量范围	精度	数字分辨率	模拟分辨率	测量面形式
507-11-012	0-10mm	0.02mm	0.005mm		A型测量面
507-12-012	10-20mm	0.02mm	0.005mm	0.01;	
507-13-012	20-30mm	0.02mm	0.005mm	0.02;	
507-14-012	30-40mm	0.02mm	0.005mm	0.05mm	
507-15-012	40-50mm	0.02mm	0.005mm		
507-11-112	0-10mm	0.02mm	0.005mm		B型测量面
507-12-112	10-20mm	0.02mm	0.005mm	0.01;	
507-13-112	20-30mm	0.02mm	0.005mm	0.02;	
507-14-112	30-40mm	0.02mm	0.005mm	0.05mm	
507-15-112	40-50mm	0.02mm	0.005mm		


测量面形式

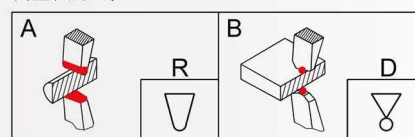

行程 20mm

货号	测量范围	精度	数字分辨率	模拟分辨率	测量面形式
507-22-012	0-20mm	0.03mm	0.005mm		A型测量面
507-23-012	10-30mm	0.03mm	0.005mm	0.01;	
507-24-012	20-40mm	0.03mm	0.005mm	0.02;	
507-25-012	30-50mm	0.03mm	0.005mm	0.05mm	
507-26-012	40-60mm	0.03mm	0.005mm		
507-22-112	0-20mm	0.03mm	0.005mm		B型测量面
507-23-112	10-30mm	0.03mm	0.005mm	0.01;	
507-24-112	20-40mm	0.03mm	0.005mm	0.02;	
507-25-112	30-50mm	0.03mm	0.005mm	0.05mm	
507-26-112	40-60mm	0.03mm	0.005mm		

测量键槽根部直径

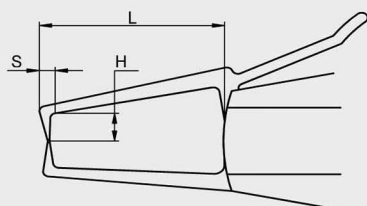

测量范围	L	S	H	测头	
				A (R)	B (D)
行程 10mm					
0-10mm	40mm	3mm	8mm	0.5mm	Φ 1.5mm
10-20mm	40mm	3mm	8mm	0.5mm	Φ 1.5mm
20-30mm	40mm	3mm	8mm	0.5mm	Φ 1.5mm
30-40mm	40mm	3mm	8mm	0.5mm	Φ 1.5mm
40-50mm	40mm	3mm	8mm	0.5mm	Φ 1.5mm
行程 20mm					
0-20mm	80mm	6.5mm	25mm	0.75mm	Φ 1.5mm
10-30mm	80mm	6.5mm	25mm	0.75mm	Φ 1.5mm
20-40mm	80mm	6.5mm	25mm	0.75mm	Φ 1.5mm
30-50mm	80mm	6.5mm	25mm	0.75mm	Φ 1.5mm
40-60mm	80mm	6.5mm	25mm	0.75mm	Φ 1.5mm